



**VAYU YU01**  
Wind Harness

**STANDARD : CONFORMING TO EN 361:2002, EN358:2018,  
EN813:2008**

INDUSTRY	IDEAL APPLICATIONS
Wind	Working at Height
Telecom	Fall Arrest
Tower	Ladder Climbing
Transmission	Work Positioning


**SPECIAL FEATURES**



WEBBING MATERIAL	WEBBING WIDTH
AZO free dyed synthetic Polyester	44 +/- 1 mm

WEBBING BREAKING STRENGTH
22kN (Min)

STITCH THREAD MATERIAL	STITCH THREAD COLOUR
High-tenacity virgin multifilament polyester	Orange

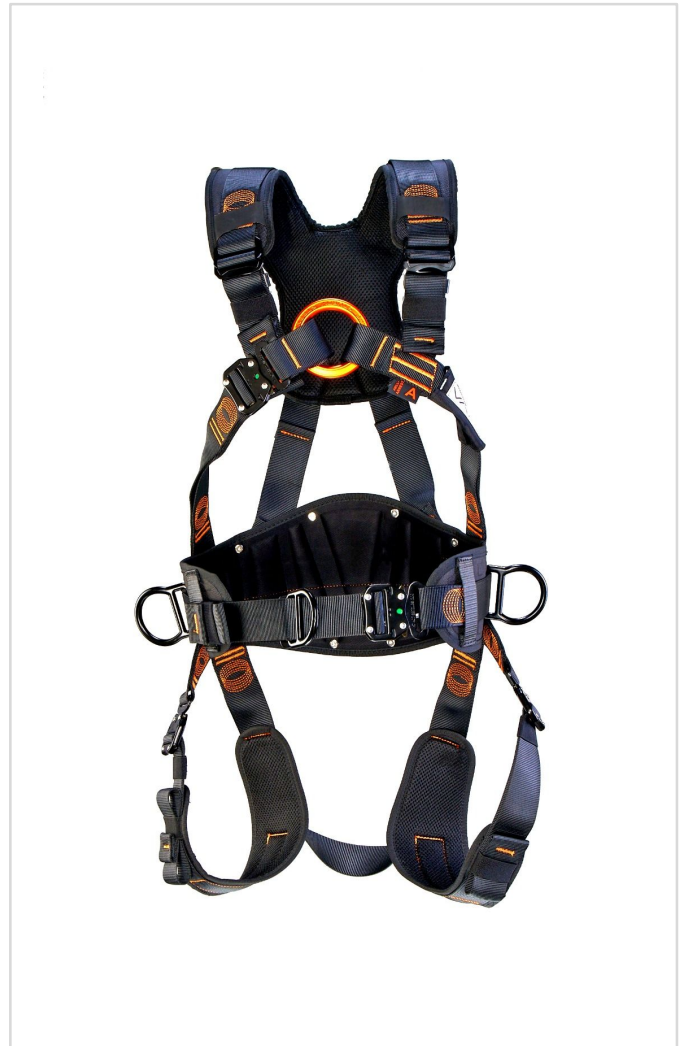

METAL COMPONENTS	HARNES COLOUR	WEIGHT
Aircraft grade Aluminum D-ring and adjuster buckles Quick buckles are also made of Aluminium	Black	2.1 kg (Approx.)

TEST COMPLIANCE - STATIC STRENGTH
Tested at each attachment element with a force of 15 KN applied for 3 min.

TEST COMPLIANCE - DYNAMIC STRENGTH
When tested at each Fall Arrest Attachment element with a torso dummy of 100 Kg mass, the full body harness withstands drop tests with a free fall distance of 4 mtr.

**Udyogi**



### FEATURES

Attachment points - One Dorsal D-ring at back, One Sternal D-ring on chest, Two Lateral D-rings at waist One Ventral D-ring at Abdomen

Big size high strength aluminium O ring as sternal attachment, for ladder climbing, makes it easy to use

Ultra-comfortable EVA material padding at waist, shoulder and thighs, made of air vent technology to improve the comfort while working at height

Polyester belt tool rings at waist to connect Tool Lanyard

Quick buckles on waist, thighs and chest make it light-weight, robust, simple, fast and easy access and donning

Waist pad is equipped with hard fibre cover to prevent any damages from abrasion

### MARKINGS

Manufacturers Logo, details & mailing address

Model No., Batch No., Serial No.

Year of Manufacture

Material

Approval & EN marking

Instruction Pictogram

### STORAGE

Store the harness in a dry area away from ultraviolet rays.

Do not store in direct/ high heat or sunlight as this may distort the Colour.

Can be stored and transported in their original cartons to avoid corrosion due to atmospheric moisture, excessive heat or cold.

### CLEANING

Use Clean piece of cloth to wipe the dust

### PACKING

5 pieces per cartoon